3D PRINTING AND DESIGN REFERENCE DOCUMENT				
Document Title:	Kinetic Sand Table			
Document No.:	1734601619			
Author(s):	jattie			
Contributor(s):				

#### **REVISION HISTORY**

Revision	Details of Modification(s)	Reason for modification	Date	Ву
0	Draft release	Document Essential References and Resource for Building a Kinetic Sandtable	2024/12/19 09:46	jattie

# **Kinetic Sand Table Design and Build**

The objectives for the project is to 3D print as many of the parts as possible and to build low budget linear stages to construct the basic system and build it up from there.

- Electronics/Controllers
  - GRBL Controller
  - CNC Shield
  - Stepper Drivers for shield
- Linear Hardware
  - Stepper motors
  - Linear Stages
  - GT2 drive belts
  - GT2 Idlers
  - GT2 Stepper Attachments
  - Belt Clamp
- Playlist <sup>1)</sup>

# **Electronics**

## **GRBL** Controller


After some extensive research I discovered grbIHAL<sup>2</sup>). grbIHAL is the updated version of GRBL. GRBL is an open-source firmware that converts G-code commands into motion control signals for CNC (Computer Numerical Control) machines. It's widely used for controlling CNC routers, mills, lathes, laser cutters, and other automated machinery.

grbIHAL essentially makes it possible to use a wide range of low cost 32 bit microcontrollers. Some popular grbIHAL supported microcontrollers are :

- RP2040: Raspberry Pi Pico
- ESP32: Popular for IoT projects
- STM32: Various models like STM32F1xx, STM32F3xx, STM32F4xx, STM32F7xx, and STM32H7xx
- LPC176x: Used in many embedded systems

- SAM3X8E: Found in Arduino Due
- Teensy 4.x: High-performance microcontrollers
- NXP iMXRT1062: Used in Teensy 4.x boards

This allows for a wide range of options to avail of to build a very low cost grbl interface. There are handy web based tools to select the controller of choice and build the firmware code for you.<sup>3</sup>. The alternative route is to build the code using VSCode. The full tutorial is here.




- Create firmware <sup>4)</sup>
- Power off the Pico 2040 by unplugging the USB, hold in BOOTSEL
- and plug it back in. Upload the firmware.
- Connect to the unit using IOSender XL<sup>5)</sup>

That's it, you now have a GRBL controller.

#### **Connecting Steppers to the GRBL controller**

The pinouts for a Pico 2040 are as follow:

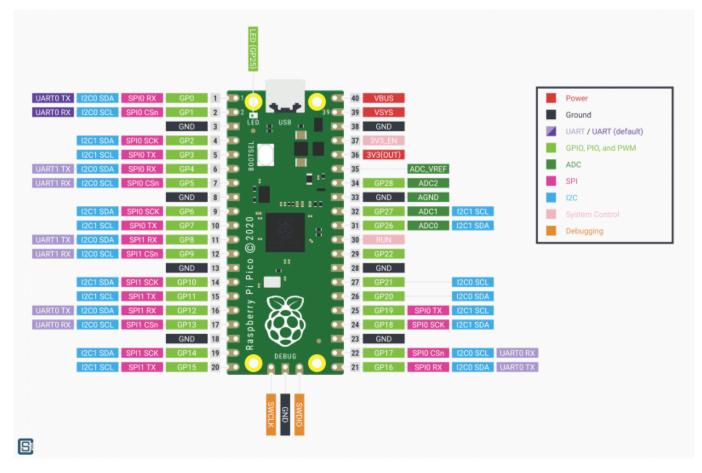

Following the grbIHAL software mapping for the firmware <sup>6)</sup> we deduce the following map to actual pinouts:

GRBL Function	Pico GP Pin
Step Output X	2
Step Output Y	3
Step Output Z	4
Direction Output X	5
Direction Output Y	6
Direction Output Z	7
Steppers Enable	8
Limit X	9
Limit Y	10
Limit Z	11

## **Stepper Drivers**

There are a few projects for Pico specific shields, however they are costly to get hold of and the Arduino community has very low cost and mature products that is compatible, or at least I believe it is and will explore this and test it for this purpose.

I will explore the CNC Shield that is discussed in detail here  $^{\mbox{\tiny 7)}}$ 

As an alternative we explored TB6600.<sup>8)9)10)</sup> These units are very low cost and available on Amazon.


The different models of these types of units are tabled below for comparison.

Last update: 2025/01/20 16:27

**Microstep Driver** Stepping Drive DM6600 DM860H DM860H ............ Stepper motor using matching 17/23/34(42/57/86) Robotronik HLTNC STEPPERDRIVER Nema23 Stepper Motor driver UPGRADED VERSION OF DM542 DRIVER DETAILS SHOW

Feature/Driver	ТВ6600	DM556	DM556T	DM542	ERP60	DM860H	DM860S	DM860T
Input Voltage	9-42V	20-50V						
Output Current	0.5-4A	0.5-5.6A	1.8-5.6A	1.8-5.6A	1.8-5.6A	1.8-5.6A	1.8-5.6A	1.8-5.6A
Microsteps	1, 2/A, 2/B, 4, 8, 16, 32	1, 2, 4, 8, 16, 32	1, 2, 4, 8, 16, 32	1, 2, 4, 8, 16, 32	1, 2, 4, 8, 16, 32	1, 2, 4, 8, 16, 32	1, 2, 4, 8, 16, 32	1, 2, 4, 8, 16, 32
Control Interface	Digital							
Protection Features	Overcurrent, Overheat							
Applications	General use, CNC machines							

The other option is smaller packaged driver like these:

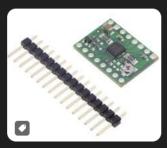

🛐 Pololu · In stock Pololu - STSPIN820 Stepper...




RobotShop DRV8825 Stepper Moto...





🛐 Pololu · In stock Pololu - STSPIN820 St...

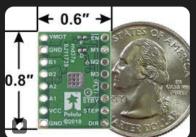

🛐 Pololu · In stock Pololu - STSPIN820 Stepper Motor ...



🛐 Pololu · In stock TB67S249FTG Stepper Motor...










🚹 F TB6



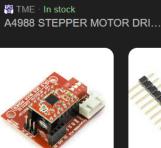

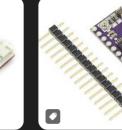







Feature/Driver	STSPIN820	DRV8834	A4988	MP6500	A5984	TB67S249	DRV8434	TMCM-1260
Operating Voltage	7-45V	2.5-10.8V	8-35V	8-40V	8-40V	8-40V	8-40V	8-40V
Max Output Current	1.5 Arms	1.5 A	2 A	2.5 A	2.5 A	2.5 A	2.5 A	2.5 A
Microstepping	Up to 1/256	Up to 1/32	Up to 1/16					
Protection Features	Overcurrent, Overtemperature, Short-circuit, Undervoltage lockout, Thermal shutdown	Overcurrent, Short-circuit, Undervoltage lockout, Overtemperature, Low-power sleep mode	Overcurrent, Short-circuit, Thermal shutdown	Overcurrent, Short-circuit, Thermal shutdown	Overcurrent, Short-circuit, Thermal shutdown	Overcurrent, Short-circuit, Thermal shutdown	Overcurrent, Short-circuit, Thermal shutdown	Overcurrent, Short-circuit, Thermal shutdown
Package Type	QFN 4×4 mm	HTSSOP/VQFN 24-pin	DIP-16	DIP-16	DIP-16	DIP-16	DIP-16	DIP-16
Applications	3D printers, Medical equipment, Industrial printers, Robotics	Toys, Printers, Cameras, Robotics	3D printers, CNC machines, Robotics					

The TMC2208 and TMC2209 are known for their silent operation due to their StealthChop technology.




The final choice of driver came down to cost and effort to implement. At the time of writing TB6600 units were available from amazon for  $\pounds$ 11,10. With optical insulated inputs<sup>11)</sup> and the cost, it's a no brainer choice for me.

## Wiring


The pico datasheet<sup>12)</sup> section 2.1 confirms use of the 3.3V output for signal purposes of up to 300mA. The TB6600 datasheet<sup>13)</sup> confirms 15mA currents required to drive the optocouplers.

The proposed microcontroller wiring from the same datasheet proposes the following:

This is an example for the common-anode connection. ( "EN" not connected )

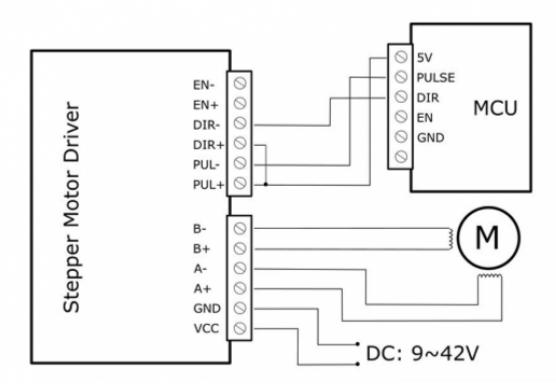


So in keeping with the proposed vendor Microcontroller wiring we then add the enable lines back in and it should look like this.

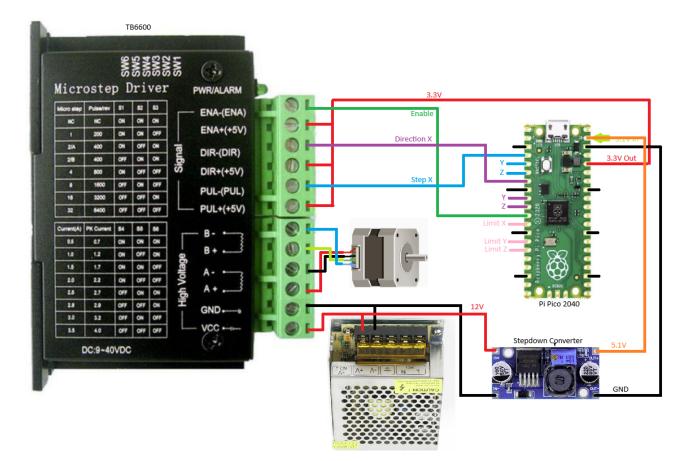

This schematic show the wiring for the X axis, the two Y axis connections for direction and step should be used instead.


These drivers are easy to use and integrate but ended up to be very noisy, the sand table is supposed to be zen, the noise is too distracting.

Last update: 2025/01/20 04\_projects:02\_kinetic\_sand\_table http://3dfaq.net/04\_projects/02\_kinetic\_sand\_table?rev=1737390443 16:27

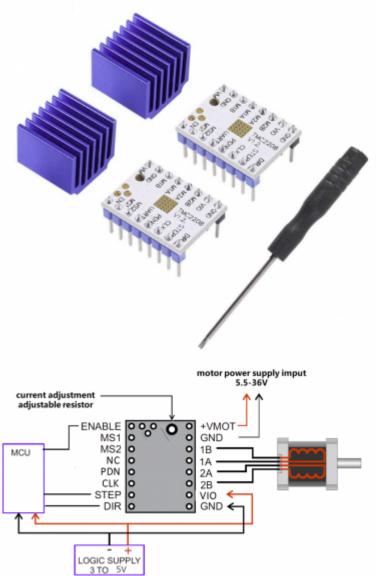


So some further research had some reasonably costed

silent steppers and I opted for some TMC2208 drivers from Amazon and tested then out. I got two for around €9.00, and wired up a motor to a pico 2040 and proceeded to do some tests.

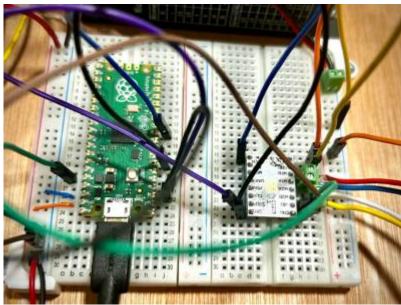


I followed this basic circuit diagram I found online, and the noise reduction was substantial. After some further research I was unable to find a good and cost effective solution to connect mi Pico 2040 to a driver board and explored pcbway that claimed to be low cost custom pcb provider, this proofed to be true and after one steep learning curve and countless hours later I have used the free version of Fusion 360 to create a double layer PC board.

http://3dfaq.net/

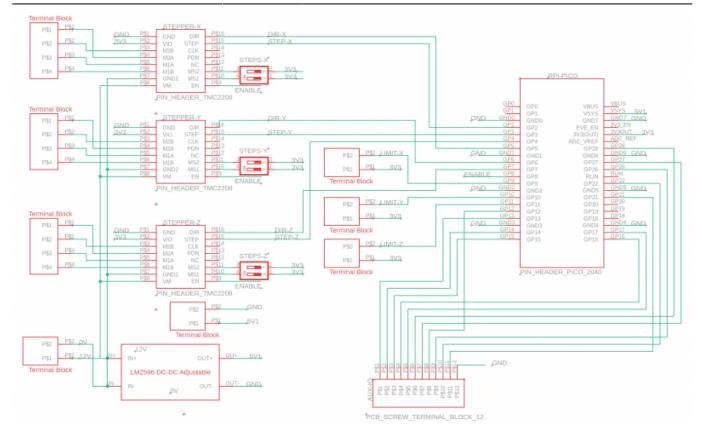

I only need two drivers for the project but decided to make provision for three motors for future projects and also break out all the other IO.

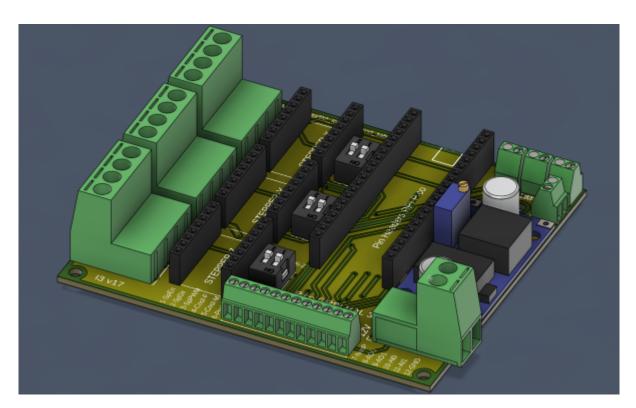

The final design include PCB headers for the pico and all the drives with pluggable terminal connectors for the motors and screw terminals for expansions. The board also includes an adjustable step down regulator for 5v power for the Pico.

The Gerber files for the board is here:

linea rail controller schematic i3 v19 2025-01-20.zip

Upload them to PCBWay to get a board manufactured.

## **Linear Hardware**

#### **Stepper Motors**

My stepper motor choice is from what I already have on hand, is popular and abundantly available. Any Nema 17 motor will suffice.

Brand	Creality 3D 42-40		
Item Name	RepRap 42 Stepper Motor		
Article number	42-40		
SKU	3204120126		
Step angle	1.8degrees		
Rated voltage	4.83V		
Current rating	1.5(A)		
Rated speed	1-1000(rpm)		
Rated torque	0.4(NM)		
Ambient temperature	-20 °C ~ + 50°C		
Length	40mm		
Application	3D printer		
Shaft	Round shaft		

Using this stepper in conjunction with a TB6600, simply set the current limit to match that of the motor selected, regardless pf the voltage supplied to the controller. The controller regulates the current limit set up from the dip switches.<sup>14</sup>


#### **Linear Stage**

For my linear stage I decided to venture off the well travelled path and investigate alternative rail options.


Browsing at my local hardware store I found polished oval rails like these and started working of a 3D printed design that can use cheap 3D printed options to turn these into a linear stage.

#### 2025/08/08 06:29

11/15

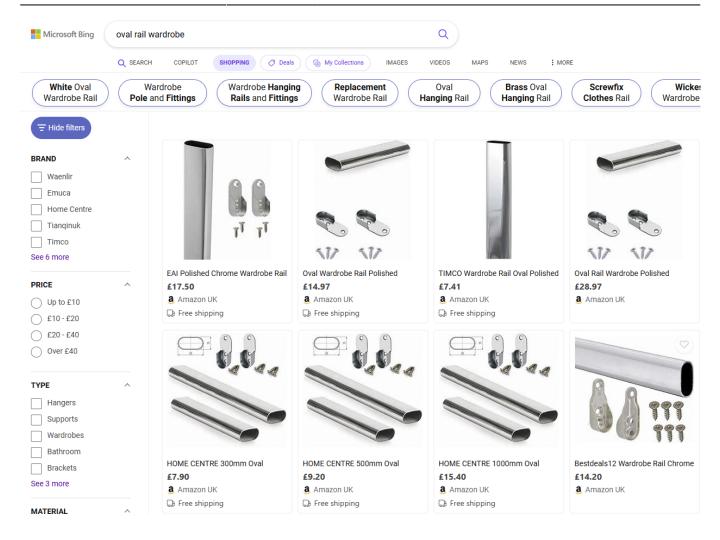


Last update: 2025/01/20 16:27

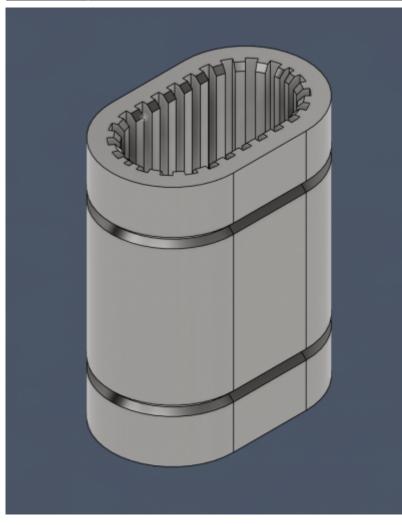

The were designed with very tight fit tolerances.

l created some oval shaped linear bearings for starters and testing them on the rails.

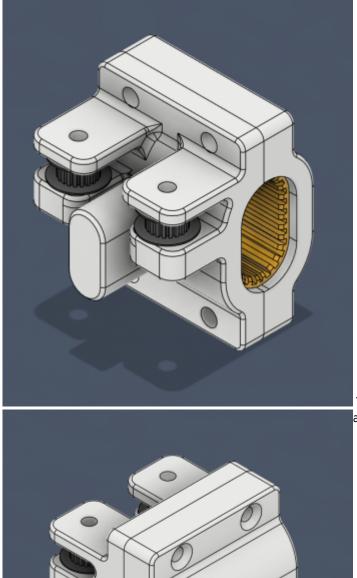

Then created some bearing holders with idler pulley holders and mounts for the cross bar.


The cross bar fit was also tight and I used a mallet to drive it on to avoid play. I realised I did not fit the bearing and designed a split bearing.

The bearings are here: https://www.printables.com/model/1108249-oval-tube-linear-bearing-15x30x50mm

The gantry sliders with bearing and idler pulleys are here: https://www.printables.com/model/1111593-oval-profile-linear-stage-single-bearing

These conceptual designs performed well enough in my initial trails, they will not work well in a 3D print design where sub millimetre tolerances are require, but is worth trying out on simpler applications will lower tolerance requirements.

Last update: 2025/01/20 16:27

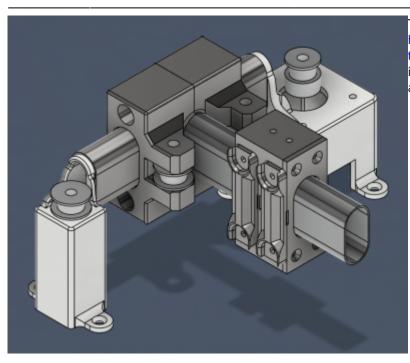

The final design for the core-xy linear stage is here: https://www.printables.com/model/1143004-budge t-core-xy-linear-rail-system. The print layout file includes a mirrored layout of the left stage stepper and idler holders.

https://github.com/texx00/sandypi

https://github.com/grbIHAL/core/blob/master/README.md

http://svn.io-engineering.com:8080/?driver=RP2040

https://github.com/terjeio/ioSender/releases/

https://github.com/grbIHAL/RP2040/blob/master/boards/generic\_map.h

https://all3dp.com/2/arduino-cnc-shield/

https://www.amazon.co.uk/gp/product/B07SBZ9SM5/ref=ox\_sc\_act\_title\_1?smid=A3G751PYK8M98N& psc=1

9) 13)

1)

5)

6)

7)

8)

10)

https://www.makerguides.com/wp-content/uploads/2019/10/TB6600-Manual.pdf

https://www.watelectronics.com/tb6600-stepper-motor-driver-module/

https://components101.com/sites/default/files/component\_datasheet/TB6600-Datasheet.pdf

12) https://datasheets.raspberrypi.com/pico/pico-datasheet.pdf

**NT** 14)

https://community.robotshop.com/forum/t/power-supply-requirements-for-stepper-motor-controller/28 483/4

From: http://3dfaq.net/ - **3D Printing Wiki** 

Permanent link: http://3dfaq.net/04\_projects/02\_kinetic\_sand\_table?rev=1737390443



Last update: 2025/01/20 16:27